ⓘ **LH mounting shown in installation instructions. RH is opposite.**

Notes:
1. See appropriate instruction sheet for closer model and arm being used for mounting dimensions and instructions.
2. EDA arm and shoe shown for reference only.
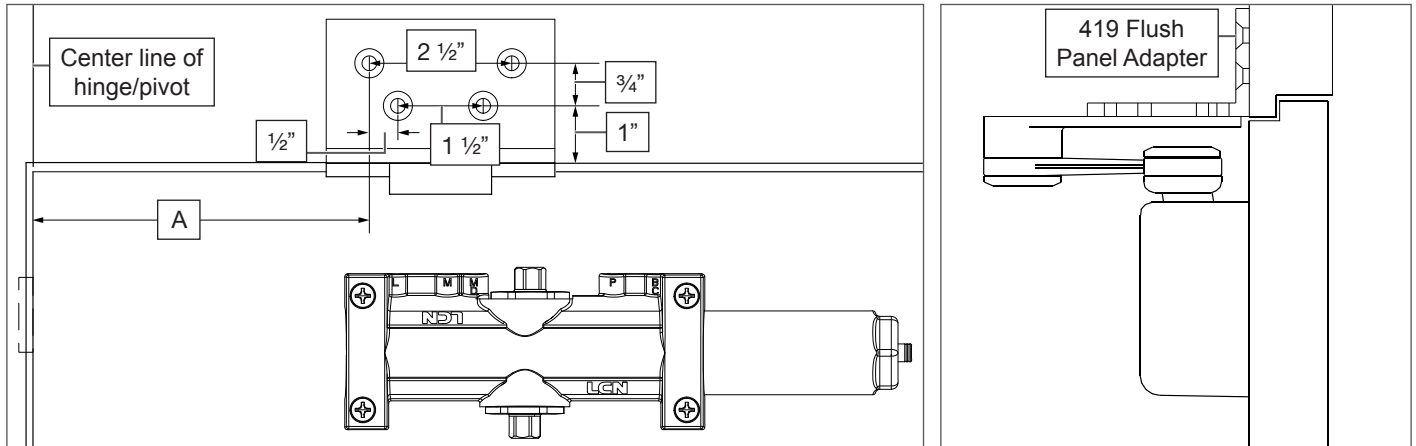
1250 Series		
Mounting Type	**Opening**	**Dimension A**
PA Mount	To 100°	9 3/8"
	101° to 130°	7 7/8"
	131° to 180°	5 7/8"
EDA Mount	To 100°	9 3/4"
	101° to 130°	8 1/4"
	131° to 180°	6 1/4"
CUSH/ SCUSH Mount	85°	11 1/4"
	90°	10 1/2"
	95°	9 3/4"
	100°	9 1/8"
	105°	8 1/2"
	110°	7 7/8"

1450 Series		
Mounting Type	**Opening**	**Dimension A**
PA Mount	To 120°	9 5/8"
	121° to 180°	7 1/8"
EDA Mount	To 120°	9 5/8"
	121° to 180°	7 1/8"
CUSH/ SCUSH Mount	85°	11 1/8"
	90°	10 3/8"
	95°	9 5/8"
	100°	9"
	105°	8 3/8"
	110°	7 3/4"

4050 Series		
Mounting Type	**Opening**	**Dimension A**
PA Mount	To 100°	9 3/8"
	101° to 130°	7 7/8"
	131° to 150°	6 7/8"
	151° to 180°	5 7/8"
EDA Mount	To 100°	9 3/8"
	101° to 130°	7 7/8"
	131° to 150°	6 7/8"
	151° to 180°	5 7/8"
CUSH/ SCUSH Mount	85°	10 3/4"
	90°	9 7/8"
	95°	9 1/4"
	100°	8 1/2"
	105°	8"
	110°	7 3/8"